

Product Change Notification - SYST-03VQKT154

Date:

07 Apr 2020

Product Category:

8-bit Microcontrollers

Affected CPNs:

|大||登|

Notification subject:

ERRATA - PIC16(L)F18857/18877 Family Silicon Errata and Data Sheet Clarification Errata Document Revision

Notification text:

SYST-03VQKT154

Microchip has released a new Product Documents for the PIC16(L)F18857/18877 Family Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at PIC16(L)F18857/18877 Family Silicon Errata and Data Sheet Clarification.

Notification Status: Final

Description of Change:

1.) Added Module 8 (Comparators).

2) Remove reference to A4

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Estimated First Ship Date: 07 Apr 2020

NOTE: Please be advised that after the estimated first ship date customers may receive pre and post change parts.

Markings to Distinguish Revised from Unrevised Devices: Traceability Code

Attachment(s):

PIC16(L)F18857/18877 Family Silicon Errata and Data Sheet Clarification

Please contact your local <u>Microchip sales office</u> with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to <u>receive Microchip PCNs via email</u> please register for our PCN email service at our <u>PCN home page</u> select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the <u>PCN FAQ</u> section.

If you wish to <u>change your PCN profile</u>, <u>including opt out</u>, please go to the <u>PCN home page</u> select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

SYST-03VQKT154 - ERRATA - PIC16(L)F18857/18877 Family Silicon Errata and Data Sheet Clarification Errata Document Revision

Affected Catalog Part Numbers (CPN)

PIC16F18857-E/ML

PIC16F18857-E/MLVAO

PIC16F18857-E/SO

PIC16F18857-E/SP

PIC16F18857-E/SS

PIC16F18857-E/SSVAO

PIC16F18857-I/ML

PIC16F18857-I/SO

PIC16F18857-I/SP

PIC16F18857-I/SS

PIC16F18857-I/SSVAO

PIC16F18857T-E/MLVAO

PIC16F18857T-E/SS

PIC16F18857T-E/SSV01

PIC16F18857T-E/SSVAO

PIC16F18857T-I/ML

PIC16F18857T-I/SO

PIC16F18857T-I/SS

PIC16F18857T-I/SSC02

PIC16F18857T-I/SSVAO

PIC16F18877-E/ML

PIC16F18877-E/MV

PIC16F18877-E/MVVAO

PIC16F18877-E/P

PIC16F18877-E/PT

PIC16F18877-I/ML

PIC16F18877-I/MV

PIC16F18877-I/P

PIC16F18877-I/PREL

PIC16F18877-I/PT

PIC16F18877T-E/MV

PIC16F18877T-E/MVV02

PIC16F18877T-E/MVVAO

PIC16F18877T-I/ML

PIC16F18877T-I/MV

PIC16F18877T-I/PT

PIC16LF18857-E/ML

PIC16LF18857-E/SO

PIC16LF18857-E/SP

PIC16LF18857-E/SS

PIC16LF18857-I/ML

PIC16LF18857-I/SO

PIC16LF18857-I/SP

PIC16LF18857-I/SS

PIC16LF18857T-I/ML

PIC16LF18857T-I/SO

Date: Tuesday, April 07, 2020

SYST-03VQKT154 - ERRATA - PIC16(L)F18857/18877 Family Silicon Errata and Data Sheet Clarification Errata Document Revision PIC16LF18857T-I/SS PIC16LF18877-E/ML PIC16LF18877-E/MV PIC16LF18877-E/P PIC16LF18877-E/PT PIC16LF18877-I/ML PIC16LF18877-I/MV PIC16LF18877-I/MVC04 PIC16LF18877-I/P PIC16LF18877-I/PT PIC16LF18877T-I/ML PIC16LF18877T-I/MV PIC16LF18877T-I/MVC04 PIC16LF18877T-I/PT PIC16LF18877T-I/PTC01 PIC16LF18877T-I/PTRA3

Date: Tuesday, April 07, 2020



PIC16(L)F18857/18877

PIC16(L)F18857/18877 Family Silicon Errata and Data Sheet Clarification

The PIC16(L)F18857/18877 family devices that you have received conform functionally to the current Device Data Sheet (DS40001825**D**), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in Table 1. The silicon issues are summarized in Table 2.

The errata described in this document will be addressed in future revisions of the PIC16(L)F18857/18877 silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of Table 2 apply to the current silicon revision (A3).

Data Sheet clarifications and corrections start on page 5, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB[®] IDE and Microchip's programmers, debuggers, and emulation tools, which are available at the Microchip corporate website (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

- Using the appropriate interface, connect the device to the hardware debugger.
- 2. Open an MPLAB IDE project.
- Configure the MPLAB IDE project for the appropriate device and hardware debugger.
- 4. Based on the version of MPLAB IDE you are using, do one of the following:
 - a) For MPLAB IDE 8, select <u>Programmer ></u> Reconnect.
 - b) For MPLAB X IDE, select <u>Window > Dashboard</u> and click the **Refresh Debug**Tool Status icon ().
- 5. Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC16(L)F18857/18877 silicon revisions are shown in Table 1.

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID ⁽¹⁾	Revision ID (Silicon Revision) ⁽²⁾		
		A2	А3	
PIC16F18857	3074h	2002h	2003h	
PIC16LF18857	3076h	2002h	2003h	
PIC16F18877	3075h	2002h	2003h	
PIC16LF18877	3077h	2002h	2003h	

- **Note 1:** The Revision ID and Device ID are located in the Configuration memory at addresses 8005h and 8006h, respectively.
 - 2: Refer to the "PIC16(L)F188XX Memory Programming Specification" (DS40001753) for detailed information on Device and Revision IDs for your specific device.

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item	Issue Summary		cted sion ⁽¹⁾
		NO.		A2	А3
Analog-to-Digital Converter with Computation (ADC2)	Computation Overflow Bit	1.1	The Computation Overflow bit will be erroneously set by the ADFLTR.	Х	
Analog-to-Digital Converter with Computation (ADC2)	ADC Conversion	1.2	When using ADCRC as the ADCC clock source there is a delay of one instruction cycle to set the ADGO bit.		
Analog-to-Digital Converter with Computation (ADC2)	Positive Voltage Reference	1.3	Using the FVR as the ADC positive voltage reference can cause missing codes.	Х	Х
Nonvolatile Memory Control	NVMREG Access	2.1	Self-writes on LF devices below 2.2V at -40°C may not work.	х	
EEPROM	Indirect Read	3.1	Indirect read of EEPROM with FSR returns unexpected value.	х	
ECCP	Compare Mode	4.1	Toggle mode may output multiple pulses when source clock has a prescaler other than 1:1.	х	
MSSP	I ² C communica- tion	5.1	Acknowledge failure on LF devices only.	Х	
Electrical Specifications	Fixed Voltage Reference (FVR) Accuracy	6.1	Fixed Voltage Reference (FVR) output tolerance may be higher than specified at temperatures below -20°C.	Х	
Secondary Oscillator (SOSC)	Low-Power Mode	7.1	SOSC may not properly operate in Low-Power mode at low temperatures.	Х	
Comparators	Offset Voltage	8.1	Comparator Input Offset value is higher than specified.	Х	Х

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

Silicon Errata Issues

Note:

This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (A3).

1. Module: Analog-to-Digital Converter with Computation (ADC²)

1.1 Computation Overflow Bit

If the sign bit of ADFLTR (bit 7 of ADFLTRH) is set, the Computation Overflow bit will also be set, even though this is not a legitimate case of an overflow occurring.

Work around

None.

Affected Silicon Revisions

A2	А3			
Χ				

1.2. ADC Conversion

When using ADCRC as the clock source for ADCC, there is a delay of one instruction cycle between the user setting the ADGO bit and being able to read it set. This can lead to a false conversion complete scenario (i.e., ADGO being cleared), depending if the user code has a bit clear test (BTFSC) instruction on the ADGO bit, immediately after setting the ADGO bit. See code example below.

e.g.

BSF ADCONO, ADGO ; Start conversion

BTFSC ADCONO, ADGO ; Is conversion done?

GOTO \$-1 ; No, test again

The BTFSC will pass the very first time in this situation.

Work around

Add a NOP instruction after setting the ADGO bit and before testing the bit for completion of conversion. See code example below.

e.g.

BSF ADCONO, ADGO ; Start conversion

NOP

BTFSC ADCONO, ADGO ; Is conversion done?

GOTO \$-1 ; No, test again

Affected Silicon Revisions

A2	А3			
Χ				

1.3 Positive Voltage Reference

Using the FVR as the positive voltage reference for the ADC can cause an increase in missing codes.

Work around

Increase the bit conversion time (TAD) to 8 us or higher.

Affected Silicon Revisions

A2	А3			
Χ	Х			

2. Module: Nonvolatile Memory Control

2.1 NVMREG Access

When performing self-writes through NVMREG access on PIC16LF18857/18877 devices with VDD below 2.2V and at temperature of -40°C, the writes may not work. This applies to both PFM and EEPROM writes.

Work around

None.

Affected Silicon Revisions

A2	А3			
Χ				

3. Module: EEPROM

3.1 Indirect Read

Performing FSR reads of Data EEPROM addresses other than the lowest address (FSR = 7000h) will return unexpected values.

Work around

Set NVMADRH:L to the desired address (F000h through F0FFh) and retrieve the EEPROM value from the NVMDATL register by setting the NV MREGS and RD bits in the NVMCON1 register.

Affected Silicon Revisions

A2	А3			
Χ				

4. Module: ECCP

4.1 Compare Mode

The ECCP Compare Toggle modes (CCPxCON<3:0> bits = 0010 or 0001) output multiple pulses instead of a single toggle pulse when its source clock has a prescaler other than 1:1.

Work aroundWork around

Use CCP Compare mode with pulse output (CCPxCON<3:0> bits = 1011) to clock a CL.

Affected Silicon Revisions

A2	А3			
Χ				

5. Module: MSSP

5.1 I²C Communication

When using the MSSP to perform I²C communication on LF devices and the voltage for VDD is above 3.0 volts, the Acknowledge signal (ACK) does not always occur after the second address byte is received, as expected. This issue exhibits itself when the MSSP is configured either for 7-bit or 10-bit addressing and in either Master or Slave mode.

The issue occurs more frequently when using 10-bit addressing in Slave mode and the lower address bits (A7-A0) are transmitted by the Master on the SDA line.

Work around

Do not exceed 3.0 volts on VDD when using an LF device in this manner.

Affected Silicon Revisions

A2	А3			
Χ				

6. Module: Electrical Specifications

6.1 Fixed Voltage Reference (FVR) Accuracy

At temperatures below -20°C, the output voltage for the FVR may be greater than the levels specified in the data sheet. This will apply to all three gain amplifier settings (1X, 2X, 4X). The affected parameter numbers found in the data sheet are: FVR01, (1X gain setting), FVR02 (2X gain setting), and FVR03 (4X gain setting).

Work around

At temperatures above -20°C, the stated tolerances in the data sheet remain in effect. Operate the FVR only at temperatures above -20°C.

Affected Silicon Revisions

A2	А3			
Χ				

7. Module: Secondary Oscillator (SOSC)

7.1 Low-Power Mode

While operating the device at low temperatures and using the SOSC in Low-Power mode (OSCCON3<6> = 0), the SOSC might fail to operate as expected.

Work around

If SOSC functionality is required at low temperatures, configure the SOSC for high-power operation (OSCCON3<6> = 1).

Affected Silicon Revisions

A2	А3			
Χ				

8. Module: Comparators

8.1 Offset Voltage

The maximum value of the input offset voltage for the comparators is increasing from $\pm 30 \text{ mV}$ to $\pm 60 \text{ mV}$.

The parameter in the data sheet is CM01, also known as VIOFF.

Work around

None.

Affected Silicon Revisions

A2	А3			
Χ	Χ			

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS40001825 \mathbf{D}):

Note: Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

None.

APPENDIX A: DOCUMENT REVISION HISTORY

Rev G Document (4/2020)

Added Module 8 (Comparators). Remove reference to A4.

Rev F Document (1/2020)

Added Rev A4 to document.

Rev E Document (4/2018)

Added Rev A3 to document.

Rev D Document (2/2018)

Added Module 7: Secondary Oscillator (SOSC).

Rev C Document (7/2017)

Added Modules 1.3 (PVR), 5 (MSSP) and 6 (Electrical Specifications).

Data Sheet Clarifications:

Removed all modules, data sheet updated.

Rev B Document (9/2016)

Modifications brought to Table 2.

Silicon Errata Issues:

Added ADC Conversion feature to Analog-to-Digital Converter with Computation (ADC2); Added EEPROM and ECCP modules.

Data Sheet Clarifications:

Added modules 9 to 15.

Rev A Document (6/2016)

Initial release of this document.

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our
 knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data
 Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKiT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, Anyln, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KleerNet, KleerNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2016-2020, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-5889-0

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



Worldwide Sales and Service

AMERICAS

Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199

Tel: 480-792-7200 Fax: 480-792-7277 Technical Support:

http://www.microchip.com/

support Web Address:

www.microchip.com

Atlanta Duluth, GA

Tel: 678-957-9614 Fax: 678-957-1455

Austin, TX Tel: 512-257-3370

Boston

Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088

Chicago Itasca, IL

Tel: 630-285-0071 Fax: 630-285-0075

Dallas

Addison, TX Tel: 972-818-7423 Fax: 972-818-2924

Detroit Novi, MI

Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983 Indianapolis

Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380

Los Angeles

Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800

Raleigh, NC Tel: 919-844-7510

New York, NY Tel: 631-435-6000

San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270

Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney Tel: 61-2-9868-6733

China - Beijing Tel: 86-10-8569-7000

China - Chengdu Tel: 86-28-8665-5511

China - Chongqing Tel: 86-23-8980-9588

China - Dongguan Tel: 86-769-8702-9880

China - Guangzhou Tel: 86-20-8755-8029

China - Hangzhou Tel: 86-571-8792-8115

China - Hong Kong SAR Tel: 852-2943-5100

China - Nanjing Tel: 86-25-8473-2460

China - Qingdao Tel: 86-532-8502-7355

China - Shanghai

Tel: 86-21-3326-8000 China - Shenyang

Tel: 86-24-2334-2829

China - Shenzhen Tel: 86-755-8864-2200

China - Suzhou Tel: 86-186-6233-1526

China - Wuhan Tel: 86-27-5980-5300

China - Xian Tel: 86-29-8833-7252

China - Xiamen Tel: 86-592-2388138

China - Zhuhai Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore Tel: 91-80-3090-4444

India - New Delhi Tel: 91-11-4160-8631

India - Pune Tel: 91-20-4121-0141

Japan - Osaka

Tel: 81-6-6152-7160

Japan - Tokyo Tel: 81-3-6880- 3770

Korea - Daegu Tel: 82-53-744-4301

Korea - Seoul Tel: 82-2-554-7200

Malaysia - Kuala Lumpur Tel: 60-3-7651-7906

Malaysia - Penang Tel: 60-4-227-8870

Philippines - Manila Tel: 63-2-634-9065

Singapore Tel: 65-6334-8870

Taiwan - Hsin Chu Tel: 886-3-577-8366

Taiwan - Kaohsiung Tel: 886-7-213-7830

Taiwan - Taipei Tel: 886-2-2508-8600

Thailand - Bangkok Tel: 66-2-694-1351

Vietnam - Ho Chi Minh Tel: 84-28-5448-2100

EUROPE

Austria - Wels Tel: 43-7242-2244-39

Fax: 43-7242-2244-393

Denmark - Copenhagen Tel: 45-4485-5910

Fax: 45-4485-2829 **Finland - Espoo** Tel: 358-9-4520-820

France - Paris Tel: 33-1-69-53-63-20

Fax: 33-1-69-30-90-79 **Germany - Garching**

Tel: 49-8931-9700 **Germany - Haan** Tel: 49-2129-3766400

Germany - Heilbronn Tel: 49-7131-72400

Germany - Karlsruhe Tel: 49-721-625370

Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44

Germany - Rosenheim Tel: 49-8031-354-560

Israel - Ra'anana Tel: 972-9-744-7705

Italy - Milan Tel: 39-0331-742611

Fax: 39-0331-466781

Italy - Padova Tel: 39-049-7625286

Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340

Norway - Trondheim Tel: 47-7288-4388

Poland - Warsaw Tel: 48-22-3325737

Romania - Bucharest Tel: 40-21-407-87-50

Spain - MadridTel: 34-91-708-08-90
Fax: 34-91-708-08-91 **Sweden - Gothenberg**

Tel: 46-31-704-60-40 Sweden - Stockholm

Tel: 46-8-5090-4654

UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820