



Product Change Notification / SYST-03IJXI646

Date:

04-May-2021

Product Category:

16-Bit - Microcontrollers and Digital Signal Controllers

PCN Type:

Document Change

Notification Subject:

ERRATA - PIC24FJ128GL306 Family Silicon Errata and Data Sheet Clarification

Affected CPNs:

[SYST-03IJXI646_Affected_CPN_05042021.pdf](#)

[SYST-03IJXI646_Affected_CPN_05042021.csv](#)

Notification Text:

SYST-03IJXI646

Microchip has released a new Product Documents for the PIC24FJ128GL306 Family Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [PIC24FJ128GL306 Family Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change: 1) Adds silicon issue 10 (Power). 2) The I2C standard uses the terminology "Master" and "Slave." The equivalent Microchip terminology used in this document is "Host" and "Client", respectively.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 4 May 2021

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachments:

[PIC24FJ128GL306 Family Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

PIC24FJ128GL306-E/MR

PIC24FJ128GL306-E/PT

PIC24FJ128GL306-I/MR

PIC24FJ128GL306-I/PT

PIC24FJ128GL306T-I/MR

PIC24FJ128GL306T-I/PT

SYST-03IJX1646 - ERRATA - PIC24FJ128GL306 Family Silicon Errata and Data Sheet Clarification

Affected Catalog Part Numbers(CPN)

PIC24FJ128GL306-E/MR

PIC24FJ128GL306-E/PT

PIC24FJ128GL306-I/MR

PIC24FJ128GL306-I/PT

PIC24FJ128GL306T-I/MR

PIC24FJ128GL306T-I/PT

**PIC24FJ128GL306 Family
Silicon Errata and Data Sheet Clarification**

The PIC24FJ128GL306 family devices conform functionally to the current Device Data Sheet (DS30010198B), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).


The errata described in this document will be addressed in future revisions of the PIC24FJ128GL306 family silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**A4**).

Data Sheet clarifications and corrections start on [page 5](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip’s programmers, debuggers and emulation tools, which are available at the Microchip corporate website (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB IDE project.
3. Configure the MPLAB IDE project for the appropriate device and hardware debugger.
4. Based on the version of MPLAB IDE you are using, do one of the following:
 - a) For MPLAB IDE 8, select *Programmer > Reconnect*.
 - b) For MPLAB X IDE, select *Window > Dashboard* and click the **Refresh Debug Tool Status** icon ().
5. Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC24FJ128GL306 family silicon revisions are shown in [Table 1](#).

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾
		A4
PIC24FJ128GL306	0x220E	0x03
PIC24FJ64GL306	0x2206	
PIC24FJ128GL305	0x220C	
PIC24FJ64GL305	0x2204	
PIC24FJ128GL303	0x220A	
PIC24FJ64GL303	0x2202	
PIC24FJ128GL302	0x2208	
PIC24FJ64GL302	0x2200	

- Note 1:** The Device IDs (DEVID and DEVREV) are located at the last two implemented addresses of configuration memory space. They are shown in hexadecimal in the format “DEVID DEVREV”.
- 2:** Refer to the “*PIC24FJ128GL306 Family Flash Programming Specification*” (DS30010194) for detailed information on Device and Revision IDs for your specific device.

PIC24FJ128GL306 FAMILY

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions ⁽¹⁾
				A4
Oscillator	Clock Switch	1.	Clock switch to FRC+PLL does not occur after MCLR.	X
Oscillator	FSCM	2.	RESET instruction in oscillator trap locks up device.	X
UART	Break Character Transmission	3.	The Transmit Shift Register Empty (TRMT) bit is unreliable when there are back-to-back Break character transmissions.	X
CCP	32-Bit Mode	4.	MCCP timer in 32-bit mode cannot be cleared by writing a zero to the Timer register.	X
I ² C	Client Mode	5.	In Client mode, an address cannot be received when the device is in Idle and the module is set for discontinue in Idle (I2CSIDL = 1).	X
I ² C	Multiple Client Mode	6.	In applications with multiple I ² C Clients and General Call enabled, unexpected behavior is observed in the unaddressed Client.	X
I ² C	Client Transmit	7.	Client transmits 0xFF if ACKDT bit is set prior to transmission.	X
LCD	Frame Counter	8.	Frame counter can be written at any time.	X
Flash Program Memory	Double Error Trap	9.	Using software breakpoints in the last page of program memory can lead to an ECC double error trap getting generated.	X
Power	Retention Sleep Mode	10.	For temperatures below -20°C, a Reset may occur when the device wakes from Retention Sleep mode.	X

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

PIC24FJ128GL306 FAMILY

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A4**).

1. Module: Oscillator

A clock switch to FRC+PLL after POR will cause the device to hang if the POSC is disabled/not present and PLLSS = PRI is selected.

Work around

If POSC is disabled/not present, then PLLSS should be set to FRC. PLLSS = PRI is an invalid configuration when POSC is not present.

Affected Silicon Revisions

A4								
X								

2. Module: Oscillator

When the device is clocked from the Primary Oscillator with PLL (XT+PLL, HS+PLL or EC+PLL), it may not recover from the oscillator failure (Fail-Safe Clock Monitor event) if a RESET instruction is executed in the oscillator trap. The device will lock up.

Work around

In the application code, the device should be started from FRC (defined in the Configuration bits). Then the clock should be switched to the Primary Oscillator with PLL.

Affected Silicon Revisions

A4								
X								

3. Module: UART

The Transmit Shift Register Empty (TRMT) bit is unreliable when there are back-to-back Break character transmissions. For back-to-back Break characters, the TRMT bit may not reflect the actual status. If user software is polling for this bit to be set, it may result in dummy bytes getting transmitted instead of Break characters.

Work around

Poll the UARTx Transmit Break bit, UTXBRK (UxSTA[11]), to be cleared instead of the TRMT bit (U1STA[8]) to be set. The UTXBRK status bit will be cleared after a Break character transmission.

Affected Silicon Revisions

A4								
X								

4. Module: CCP

The MCCP timer in 32-bit mode cannot be cleared by writing a zero to the Timer register.

Work around

Switch to 16-bit mode, clear both low and high words and then go back to 32-bit mode.

Affected Silicon Revisions

A4								
X								

5. Module: I²C

In I²C In Client mode, an address cannot be received when the device is in Idle and the module is set for discontinue in Idle (I2CSIDL = 1).

Work around

None.

Affected Silicon Revisions

A4								
X								

PIC24FJ128GL306 FAMILY

6. Module: I²C

In applications with multiple I²C Clients and General Call (GCEN (I2CxCONL[7]) = 1) is enabled, unexpected behavior is observed in the unaddressed Client when the data payload of the addressed Client matches the general call address (00h).

When the issue occurs, unexpected data might be received in the unaddressed Client. If Address Hold is enabled (AHEN (I2CxCONH[1]) = 1), then I²C will erroneously ACK the byte.

Work around

If Address Hold is enabled (I2CxCONH[1] = 1), Acknowledge Data (ACKDT (I2CxCONL[5]) = 1) should be set during initialization.

Instead of Client interrupt, poll the Receive Buffer Full Status bit and read the receive buffer to clear the unwanted data.

Affected Silicon Revisions

A4								
X								

7. Module: I²C

When the Client is transmitting data, if Acknowledge Data (ACKDT (I2CxCONL[5]) = 1) is set before the Client starts transmission, then the second data transmitted will be 0xFF, irrespective of the actual data in I2CxTRN.

Work around

Clear the ACKDT bit before Client transmission.

Affected Silicon Revisions

A4								
X								

8. Module: LCD

The LCD Frame Counter register (LCDFCx) can be written while the LCD Enhanced mode is active, which can impact blink and blank frame timings configured before Enhanced mode was enabled.

Work around

Software should only write FCx register bits when LCD Frame Counter x is disabled or ELCDEN = 0.

Affected Silicon Revisions

A4								
X								

9. Module: Flash Program Memory

Using software breakpoints in the last page of program memory can lead to an ECC double error trap getting generated.

Work around

Avoid using software breakpoints in the last page; use hardware breakpoints instead.

Affected Silicon Revisions

A4								
X								

10. Module: Power

For a temperature below -20°C, a device Reset may occur occasionally when the device wakes from Retention Sleep mode (RETEN bit (RCON[12]) = 1, LPCFG bit (FPOR[2]) = 0). The BOR, POR and EXTR bits in the RCON register are set erroneously for this Reset.

Work around

None.

Affected Silicon Revisions

A4								
X								

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (30010198B):

<p>Note: Corrections are shown in bold. Where possible, the original bold text formatting has been removed for clarity.</p>

1. Module: Electrical Characteristics

Note 3 in **TABLE 30-32: A/D Module Specifications** has been changed as shown below in **bold**:

Code 1023 can have a DNL error of ≥ -1.5 LSB to < 1 LSB, code 2047 can have a DNL error of ≥ -1.5 LSB to < 1.5 LSB and code 3071 can have a DNL error of > -1 LSB to < 2.5 LSB.

2. Module: UART

REGISTER 17-6: UxADMD: UARTx Address Detect and Match Register is unimplemented.

The address match detect feature is not available in this device.

PIC24FJ128GL306 FAMILY

APPENDIX A: DOCUMENT REVISION HISTORY

Rev A Document (7/2020)

Initial release of this document; issued for Silicon Revision A4.

Rev B Document (5/2021)

Adds silicon issue 10 ([Power](#)).

The I²C standard uses the terminology “Master” and “Slave.” The equivalent Microchip terminology used in this document is “Host” and “Client”, respectively.

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods being used in attempts to breach the code protection features of the Microchip devices. We believe that these methods require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Attempts to breach these code protection features, most likely, cannot be accomplished without violating Microchip's intellectual property rights.
- Microchip is willing to work with any customer who is concerned about the integrity of its code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable." Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication is provided for the sole purpose of designing with and using Microchip products. Information regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL OR CONSEQUENTIAL LOSS, DAMAGE, COST OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGL00, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzr, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2020-2021, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-8191-1

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office

2355 West Chandler Blvd.

Chandler, AZ 85224-6199

Tel: 480-792-7200

Fax: 480-792-7277

Technical Support:

<http://www.microchip.com/support>

Web Address:

www.microchip.com

Atlanta

Duluth, GA

Tel: 678-957-9614

Fax: 678-957-1455

Austin, TX

Tel: 512-257-3370

Boston

Westborough, MA

Tel: 774-760-0087

Fax: 774-760-0088

Chicago

Itasca, IL

Tel: 630-285-0071

Fax: 630-285-0075

Dallas

Addison, TX

Tel: 972-818-7423

Fax: 972-818-2924

Detroit

Novi, MI

Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983

Indianapolis

Noblesville, IN

Tel: 317-773-8323

Fax: 317-773-5453

Tel: 317-536-2380

Los Angeles

Mission Viejo, CA

Tel: 949-462-9523

Fax: 949-462-9608

Tel: 951-273-7800

Raleigh, NC

Tel: 919-844-7510

New York, NY

Tel: 631-435-6000

San Jose, CA

Tel: 408-735-9110

Tel: 408-436-4270

Canada - Toronto

Tel: 905-695-1980

Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney

Tel: 61-2-9868-6733

China - Beijing

Tel: 86-10-8569-7000

China - Chengdu

Tel: 86-28-8665-5511

China - Chongqing

Tel: 86-23-8980-9588

China - Dongguan

Tel: 86-769-8702-9880

China - Guangzhou

Tel: 86-20-8755-8029

China - Hangzhou

Tel: 86-571-8792-8115

China - Hong Kong SAR

Tel: 852-2943-5100

China - Nanjing

Tel: 86-25-8473-2460

China - Qingdao

Tel: 86-532-8502-7355

China - Shanghai

Tel: 86-21-3326-8000

China - Shenyang

Tel: 86-24-2334-2829

China - Shenzhen

Tel: 86-755-8864-2200

China - Suzhou

Tel: 86-186-6233-1526

China - Wuhan

Tel: 86-27-5980-5300

China - Xian

Tel: 86-29-8833-7252

China - Xiamen

Tel: 86-592-2388138

China - Zhuhai

Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore

Tel: 91-80-3090-4444

India - New Delhi

Tel: 91-11-4160-8631

India - Pune

Tel: 91-20-4121-0141

Japan - Osaka

Tel: 81-6-6152-7160

Japan - Tokyo

Tel: 81-3-6880-3770

Korea - Daegu

Tel: 82-53-744-4301

Korea - Seoul

Tel: 82-2-554-7200

Malaysia - Kuala Lumpur

Tel: 60-3-7651-7906

Malaysia - Penang

Tel: 60-4-227-8870

Philippines - Manila

Tel: 63-2-634-9065

Singapore

Tel: 65-6334-8870

Taiwan - Hsin Chu

Tel: 886-3-577-8366

Taiwan - Kaohsiung

Tel: 886-7-213-7830

Taiwan - Taipei

Tel: 886-2-2508-8600

Thailand - Bangkok

Tel: 66-2-694-1351

Vietnam - Ho Chi Minh

Tel: 84-28-5448-2100

EUROPE

Austria - Wels

Tel: 43-7242-2244-39

Fax: 43-7242-2244-393

Denmark - Copenhagen

Tel: 45-4485-5910

Fax: 45-4485-2829

Finland - Espoo

Tel: 358-9-4520-820

France - Paris

Tel: 33-1-69-53-63-20

Fax: 33-1-69-30-90-79

Germany - Garching

Tel: 49-8931-9700

Germany - Haan

Tel: 49-2129-3766400

Germany - Heilbronn

Tel: 49-7131-72400

Germany - Karlsruhe

Tel: 49-721-625370

Germany - Munich

Tel: 49-89-627-144-0

Fax: 49-89-627-144-44

Germany - Rosenheim

Tel: 49-8031-354-560

Israel - Ra'anana

Tel: 972-9-744-7705

Italy - Milan

Tel: 39-0331-742611

Fax: 39-0331-466781

Italy - Padova

Tel: 39-049-7625286

Netherlands - Drunen

Tel: 31-416-690399

Fax: 31-416-690340

Norway - Trondheim

Tel: 47-7288-4388

Poland - Warsaw

Tel: 48-22-3325737

Romania - Bucharest

Tel: 40-21-407-87-50

Spain - Madrid

Tel: 34-91-708-08-90

Fax: 34-91-708-08-91

Sweden - Gothenberg

Tel: 46-31-704-60-40

Sweden - Stockholm

Tel: 46-8-5090-4654

UK - Wokingham

Tel: 44-118-921-5800

Fax: 44-118-921-5820