

## Active Errata List

- During UART Reception, Clearing REN May Generate Unexpected IT
- Timer 2 – Baud Rate Generator – Long Start Time
- C51 Core – Bad Exit of Power-down in X2 Mode
- PCA – Incorrect Behavior with CPU X2 Mode Bit of HSB
- Timer0/1 – Extra Interrupt
- Boot process - Upper 2Kbytes execution with BLJB=0

## Errata History

Lot Number	Errata List
All	1, 2, 3, 4, 5, 6

## Errata Descriptions

### 1. During UART Reception, Clearing REN May Generate Unexpected IT

During UART reception, if the REN bit is cleared between start bit detection and the end of reception, the UART will not discard the data (RI is set).

#### Workaround

Test REN at the beginning of Interrupt routine directly after CLR RI, and run the Interrupt routine code only if REN is set.

### 2. Timer 2 – Baud Rate Generator – Long Start Time

When Timer 2 is used as a baud rate generator, TH2 is not loaded with RCAP2H at the beginning, then UART is not operational before 10,000 machine cycles.

#### Workaround

Add the initialization of TH2 and TL2 in the initialization of Timer 2.

### 3. C51 Core – Bad Exit of Power-down in X2 Mode

When exiting power-down mode by interrupt while CPU is in X2 mode, it leads to bad execution of the first instruction run when CPU restarts.

#### Workaround

Set the CPU in X1 mode directly before entering power-down mode.

### 4. PCA – Incorrect behavior with CPU X2 mode bit of HSB

When starting the microcontroller in X2 mode upon reset with the X2 fuse bit of the HSB, the PCA may not work properly when configured with Timer 0 in X1 mode as clock input.

#### Workaround

Set the CPU in X2 mode by software by writing CKCON register at the begin of the application.

### 5. Timer0/1 – Extra Interrupt

When Timer0 is in X1 mode and Timer1 in X2 mode and vice versa, extra interrupt may randomly occur for Timer0 or Timer1.

#### Workaround

Use the same mode for the two timers..



80C51 MCUs

AT89C51RD2

AT89C51ED2

Errata Sheet

Rev. 4257D-8051-04/04



## 6. Boot Process - Upper 2Kbytes Execution with BLJB = 0

In case of Boot process with BLJB = 0 and BSB = 00, the User Application is executed but the program space located in the upper 2KBytes of the 64KBytes on chip Flash memory cannot be executed. This is due to ENBOOT bit which is set in this Bootloader flow.

### Workaround

Clear ENBOOT bit at the beginning of user application software.

## Active UART Bootloader Errata List

- API program Data Byte - Incorrect Return Value
- API program Data Page - Incorrect Return Value

## UART Bootloader Errata History

Version Number	Errata List
0.0 (1.0.0 displayed by FLIP)	1,2

## UART Bootloader Errata Description

### 1. API Program Data Byte - Incorrect Return Value

The PROGRAM DATA BYTE API returns the '0xXX' instead of 0x00 in ACC, but the programmig operation is sucessfully completed.

### 2. API Program Data Page- Incorrect Return Value

The PROGRAM DATA PAGE API returns the '0xXX' instead of 0x00 in ACC, but the programmig operation is sucessfully completed.



## Atmel Corporation

2325 Orchard Parkway  
San Jose, CA 95131, USA  
Tel: 1(408) 441-0311  
Fax: 1(408) 487-2600

## Regional Headquarters

### Europe

Atmel Sarl  
Route des Arsenalux 41  
Case Postale 80  
CH-1705 Fribourg  
Switzerland  
Tel: (41) 26-426-5555  
Fax: (41) 26-426-5500

### Asia

Room 1219  
Chinachem Golden Plaza  
77 Mody Road Tsimshatsui  
East Kowloon  
Hong Kong  
Tel: (852) 2721-9778  
Fax: (852) 2722-1369

### Japan

9F, Tonetsu Shinkawa Bldg.  
1-24-8 Shinkawa  
Chuo-ku, Tokyo 104-0033  
Japan  
Tel: (81) 3-3523-3551  
Fax: (81) 3-3523-7581

## Atmel Operations

### Memory

2325 Orchard Parkway  
San Jose, CA 95131, USA  
Tel: 1(408) 441-0311  
Fax: 1(408) 436-4314

### Microcontrollers

2325 Orchard Parkway  
San Jose, CA 95131, USA  
Tel: 1(408) 441-0311  
Fax: 1(408) 436-4314

La Chantrerie  
BP 70602  
44306 Nantes Cedex 3, France  
Tel: (33) 2-40-18-18-18  
Fax: (33) 2-40-18-19-60

### ASIC/ASSP/Smart Cards

Zone Industrielle  
13106 Rousset Cedex, France  
Tel: (33) 4-42-53-60-00  
Fax: (33) 4-42-53-60-01

1150 East Cheyenne Mtn. Blvd.  
Colorado Springs, CO 80906, USA  
Tel: 1(719) 576-3300  
Fax: 1(719) 540-1759

Scottish Enterprise Technology Park  
Maxwell Building  
East Kilbride G75 0QR, Scotland  
Tel: (44) 1355-803-000  
Fax: (44) 1355-242-743

### RF/Automotive

Theresienstrasse 2  
Postfach 3535  
74025 Heilbronn, Germany  
Tel: (49) 71-31-67-0  
Fax: (49) 71-31-67-2340

1150 East Cheyenne Mtn. Blvd.  
Colorado Springs, CO 80906, USA  
Tel: 1(719) 576-3300  
Fax: 1(719) 540-1759

### Biometrics/Imaging/Hi-Rel MPU/ High Speed Converters/RF Datacom

Avenue de Rochepleine  
BP 123  
38521 Saint-Egreve Cedex, France  
Tel: (33) 4-76-58-30-00  
Fax: (33) 4-76-58-34-80

---

## Literature Requests

[www.atmel.com/literature](http://www.atmel.com/literature)

**Disclaimer:** Atmel Corporation makes no warranty for the use of its products, other than those expressly contained in the Company's standard warranty which is detailed in Atmel's Terms and Conditions located on the Company's web site. The Company assumes no responsibility for any errors which may appear in this document, reserves the right to change devices or specifications detailed herein at any time without notice, and does not make any commitment to update the information contained herein. No licenses to patents or other intellectual property of Atmel are granted by the Company in connection with the sale of Atmel products, expressly or by implication. Atmel's products are not authorized for use as critical components in life support devices or systems.

© Atmel Corporation 2004. All rights reserved. Atmel® and combinations thereof are the registered trademarks of Atmel Corporation or its subsidiaries. Other terms and product names may be the trademarks of others.



Printed on recycled paper.