







## **Model Number**

#### UC2000-30GM-E6R2-V15-Y234253


Single head system

#### **Features**

- Synchronization options
- **Temperature compensation**
- **Custom configuration**
- Programming plug permanently bonded and not removable

## **Diagrams**

## Characteristic response curve

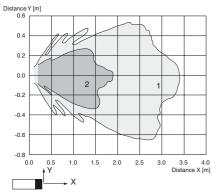

Curve 1: flat surface 100 mm x 100 mm Curve 2: round bar, Ø 25 mm

# **Technical data**

General specifications	
Sensing range	80 2000 mm
Adjustment range	120 2000 mm
Unusable area	0 80 mm
Standard target plate	100 mm x 100 mm
Transducer frequency	approx. 180 kHz
Response delay	195 ms

Indicators/operating means

LED green solid: Power-on LED yellow 1 solid Switching state switch output 1 LED yellow 2 solid: Switching state switch output 2

LED red flashing: error Temperature/TEACH-IN connector Temperature compensation

**Electrical specifications** Operating voltage UB 10 ... 30 V DC , ripple 10  $\%_{\mbox{\scriptsize SS}}$ 

No-load supply current I<sub>0</sub>  $\leq$  50 mA

Interface

Interface type

Input/Output

Synchronization bi-directional

0 level -U<sub>B</sub>...+1 V 1 level: +4 V...+U<sub>B</sub>

input impedance: > 12 KOhm

synchronization pulse: ≥ 100 µs, synchronization interpulse

RS 232, 9600 Bit/s, no parity, 8 data bits, 1 stop bit

period: ≥ 2 ms

Synchronization frequency Common mode operation

Multiplex operation  $\leq$  30 Hz / n , n = number of sensors , n  $\leq$  5

Output

Output type 2 switch outputs PNP, NO

Rated operating current I<sub>e</sub> 200 mA , short-circuit/overload protected

Voltage drop U<sub>d</sub> ≤ 2.5 V

Repeat accuracy ≤ 0.1 % of full-scale value

Switching frequency f ≤ 2.5 Hz

Range hysteresis H 1 % of the set operating distance

Temperature influence  $\leq$  2 % from full-scale value (with temperature compensation)

Ambient conditions

Ambient temperature -25 ... 70 °C (-13 ... 158 °F)

-40 ... 85 °C (-40 ... 185 °F) Storage temperature

Mechanical specifications

Connection type Connector M12 x 1, 5-pin

Protection degree **IP65** 

Material

Housing stainless steel (1.4305 / AISI 303)

PBT plastic parts

Transducer epoxy resin/hollow glass sphere mixture; polyurethane foam

140 a

Factory settings Output 1

A1: 1500 mm, NO contact Output 2 A2:500 mm, NO contact

Compliance with standards and

directives

Mass

Standard conformity

EN 60947-5-2:2007 Standards

IEC 60947-5-2:2007

## Approvals and certificates


UL approval cULus Listed, General Purpose CSA approval cCSAus Listed, General Purpose

CCC approval CCC approval / marking not required for products rated

≤36 V

www.pepperl-fuchs.com


## **Dimensions**

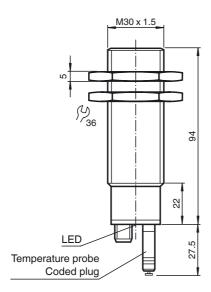

# **Electrical Connection**

Standard symbol/Connection:





Core colors in accordance with EN 60947-5-2.

# **Pinout**

## **Connector V15**



## **Accessories**

## **BF 30**

Mounting flange, 30 mm

Mounting flange with dead stop, 30 mm

Universal mounting bracket for cylindrical sensors with a diameter of 5 ... 30 mm

# UVW90-M30

Ultrasonic -deflector

## UVW90-K30

Ultrasonic -deflector

## V15-W-2M-PUR

Female cordset, M12, 5-pin, PUR cable

## V15-G-2M-PVC

Female cordset, M12, 5-pin, PVC cable

# **Additional Information**

# Switch point mode

Switch point 1 Switch point 2 A 1 (N.O.) Switch output 1 A 2 (N.O.) Switch output 2

**PEPPERL+FUCHS** 

## **Description of the sensor functions**

## **Synchronization**

This sensor features a synchronization input for the possible suppression of ultrasonic mutual interference. If this input is not connected, the sensor will operate using internally generated clock pulses. It can be synchronized by applying an external square wave. The synchronization pulse falling edge triggers each transmission of a single ultrasonic pulse. If the synchronization signal remains low for ≥1 second, the sensor will revert to non-synchronized mode. Non-synchronized mode can also be activated by opening the signal connection to the synchronization input.(See note below)

If the synchronization input goes to a high level for > 1 second, the sensor will switch to standby mode, indicated by green LED. In this mode the outputs will remain in the last valid output state.

The synchronization function cannot be activated during programming mode and vice versa.

## The following synchronization modes are possible:

- 1. Two to five sensors can be synchronized together by interconnecting their respective synchronization inputs. In this case each sensor alternately transmits ultrasonic pulses in a self multiplexing mode. No two sensors will transmit pulses at the same time.
- 2. Multiple sensors can be controlled by the same external synchronization signal. In this mode the sensors are triggered in parallel and are synchronized by a common external synchronization pulse.
- 3. A separate synchronization pulse can be sent to each individual sensor. In this mode the sensors operate in external multiplex mode.
- 4. A high level on the synchronization input disables the sensor.

Sensor response times will increase proportionally to the number of sensors that are in the synchronization string. This is a result of the multiplexing of the ultrasonic transmit and receive signal and the resulting increase in the measurement cycle time.

#### Note:


If the option for synchronization is not used, the synchronization input has to be connected to ground (0V) or the sensor has to be operated via a V1 cordset (4-pin).

## **LED Displays**

Displays in dependence on operating mode	Dual LED green	LED red	LED yellow A1	LED yellow A2
Normal mode temperature compensated	on	off	switch state A1	switch state A2
Standby	flashes	off	previous state	previous state

LED ON indicates closed switch output.

### **LED-Window**



#### **Mounting conditions**

If the sensor is installed in places where the operating temperature can fall below 0 °C, the BF30, BF30-F or BF 5-30 fixing clamp must be used.

#### Attention

The programming plug is permanently bonded to the sensor. It may not be solved by violence. Damaging the sensor would be the result.