## **Index Plungers** • simple finish

## 22120.0795



### **Product Description**

Application is limited to cases not requiring a precise positioning. Simple finish with very small dimensions.

#### **Material**

#### **Body**

· Stainless steel 1.4305

#### Locking pin

Stainless steel 1.4305

### Knob

• Thermoplastic PA 6, black, dull

#### Operation

When using locking index plungers, the knob is pulled-out, turned 90° and secured by a notched catch (when locking pin should not overhang).

#### More information


#### Notes

Lock nuts have to be purchased separately. Knob not removable.

#### **Further products**

Locating Bushings, for index bolts and index plungers

#### **Drawing**

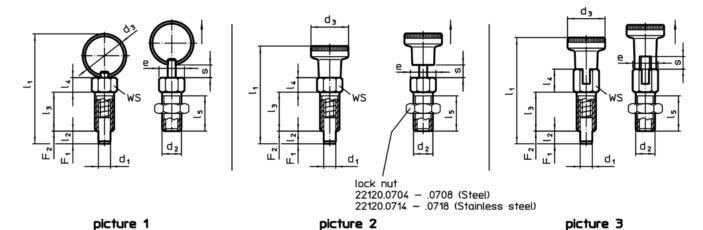

# Order information

	Dimensions									ws	Tightening Spring load <sup>1)</sup>				Ĭ	Art. No.	
<b>d</b> ₁ h9	d <sub>2</sub>	d <sub>3</sub>	e	I <sub>1</sub>	l <sub>2</sub> min.	l <sub>3</sub>	I <sub>4</sub>	l <sub>5</sub>	s min.		max.	F <sub>1</sub> ~	F <sub>2</sub> ~	min.	max.		
	[mm]								[mm]	[Nm]	ı	[N]	[°C	; ]	[g]		
with I	with knob and locking – picture 3, stainless steel																
5	M8	16	9.2	43.5	5	16	9.5	13.5	5	8	7	5	24	-30	80	9	22120.0795

<sup>1)</sup> statistical average value


Erwin Halder KG

www.halder.com Page 1 of 2
Published on: 5.11.2022

#### **Accessories**

	Dimensions d <sub>2</sub>	Wrench size	ă	Art. No.
	[mm]	[mm]	[g]	
stainless steel				
	M 8	13	2.8	22120.0715

## **Application example**

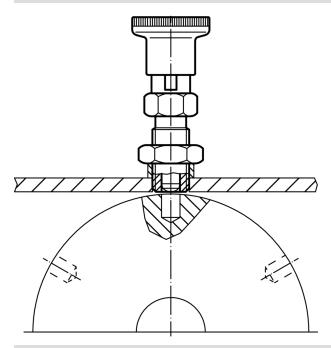

## Compliance

### **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863

#### Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 10.06.2022

#### Does not contain Proposition 65 substances

No Proposition 65 substances included https://www.P65Warnings.ca.gov/

#### **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2
Published on: 5.11.2022