





 $\epsilon$ 





# **Model Number**

### OBR15M-R200-2EP-IO-V15

Retroreflective sensor with polarization filter

with 5-pin, M12 x 1 connector

### **Features**

- Medium design with versatile mounting options
- Extended temperature range -40°C ... 60°C
- · High degree of protection IP69K
- IO-link interface for service and process data

## **Product information**


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design—from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

# **Dimensions**

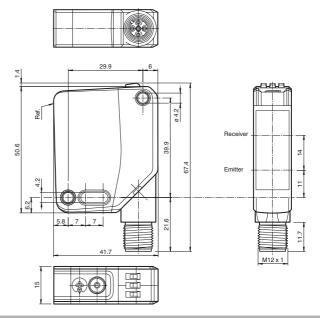

## **Electrical connection**




### **Pinout**

Wire colors in accordance with EN 60947-5-2



BN (brown)
WH (white)
BU (blue)
BK (black)
GY (gray)

## Indicators/operating means

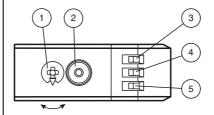

1	Sensitivity adjustment	
2	Light-on / dark-on changeover switch	
3	Operating indicator / dark on	GN
4	Signal indicator	YE
5	Operating indicator / light on	GN



Technical data		
General specifications		
Effective detection range		0 15 m
Reflector distance		0.02 15 m
Threshold detection range		18.5 m
Reference target		H85-2 reflector
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Polarization filter		yes
Diameter of the light spot		approx. 520 mm at a distance of 15 m
Angle of divergence		2°
Ambient light limit		EN 60947-5-2 : 60000 Lux
Functional safety related parame	eters	
MTTF <sub>d</sub>	310.0	724 a
Mission Time (T <sub>M</sub> )		20 a
Diagnostic Coverage (DC)		60 %
J ,		00 /6
Indicators/operating means		150
Operation indicator		LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		Yellow LED: Permanently lit - light path clear Permanently off - object detected Flashing (4 Hz) - insufficient operating reserve
Control elements		Light-on/dark-on changeover switch
Control elements		sensitivity adjustment
Electrical specifications		
Operating voltage	U <sub>B</sub>	10 30 V DC
Ripple		max. 10 %
No-load supply current	I <sub>0</sub>	< 18 mA at 24 V Operating voltage
Protection class	-0	III
Interface		
Interface type		IO-Link ( via C/Q = pin 4 )
Device profile		Identification and diagnosis
Device profile		Smart Sensor type 2.4
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		2.3 ms
Process data witdh		Process data input 2 Bit
		Process data output 2 Bit
SIO mode support		yes
Device ID		0x111203 (1118723)
Compatible master port type		A
Input		
Test input		emitter deactivation at +U <sub>B</sub>
Output		onition dodottvation at 10B
Switching type		The switching type of the sensor is adjustable. The default
Ownersing type		setting is: C/Q - Pin4: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link
Signal output		/Q - Pin2: NPN normally closed / light-on, PNP normally open / dark-on 2 push-pull (4 in 1)outputs, short-circuit protected, reverse
Switching voltage		polarity protected, overvoltage protected max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U <sub>d</sub>	≤ 1.5 V DC
Switching frequency	f	1000 Hz
Response time	•	0.5 ms
Conformity		o.o me
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Ambient conditions Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 70 °C (-40 158 °F)
- '		10 70 0 ( 10 100 1 )
Mechanical specifications		15 mm
Housing width		
Housing height		50.6 mm
Housing depth		41.7 mm
Degree of protection		IP67 / IP69 / IP69K
Connection		5-pin, M12 x 1 connector, 90° rotatable
Material		DO (D. )
Housing		PC (Polycarbonate)

### Accessories

### IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

#### V15-W-2M-PUR

Female cordset, M12, 5-pin, PUR cable

### V15-G-2M-PUR

Female cordset, M12, 5-pin, PUR cable

### **OMH-MLV12-HWK**

Mounting bracket for series MLV12 sensors

## OMH-R200-01

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

#### **OMH-R20x-Quick-Mount**

Quick mounting accessory

#### OMH-MLV12-HWG

Mounting bracket for series MLV12 sensors

### **REF-H85-2**

Reflector, rectangular 84.5 mm x 84.5 mm, mounting holes

#### REF-C110-2

Reflector, round ø 84 mm, central mounting hole

#### REF-H50

Reflector, rectangular 51 mm x 61 mm, mounting holes, fixing strap

## REF-VR10

Reflector, rectangular 60 mm x 19 mm, mounting holes

## OFR-100/100

Reflective tape 100 mm x 100 mm

#### V1-G-2M-PUR

Female cordset, M12, 4-pin, PUR cable

### V1-W-2M-PUR


Female cordset, M12, 4-pin, PUR cable


Other suitable accessories can be found at www.pepperl-fuchs.com

Date of issue: 2019-10-31 295670-100014\_eng.xml

Optical face	PMMA
Mass	арргох. 37 g
Approvals and certificates	
Approvais and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
CCC approval	CCC approval / marking not required for products rated ≤36 V

### **Curves/Diagrams**

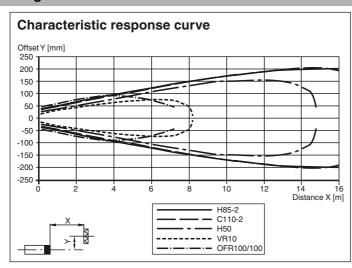

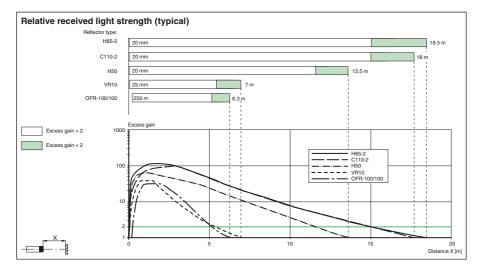

### **Functions and Operation**

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

## Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

## **Light-on / Dark-on Configuration**

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

## **Restore Factory Settings**

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range / sensitivity adjuster for more than 180 degrees.