# **Index Bolts**

# 22120.0328



# **Product Description**

Index bolts are used for indexing purposes. Plastic cover for grip allows better handling.

#### **Material**

## **Body**

· Stainless steel 1.4305

#### Locking pin

Stainless steel 1.4305, nickel-plated

#### Catch

• Dry powdered metal 1.4404

## Operation

By turning the index bolt 180° the locking pin will be pulled-in and secured by a notched catch (when locking pin should not overhang).

#### More information


#### **Notes**

Lock nuts have to be purchased separately.

## **Further products**

- Mounting Blocks, for index bolts and index plungers, die-cast
- Locating Bushings, for index bolts and index plungers
- Mounting Blocks, for index bolts and index plungers

## Drawing

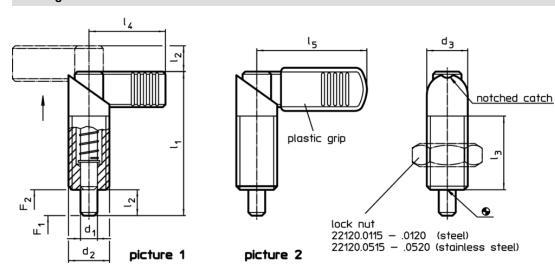

Erwin Halder KG

## **Order information**

Dimensions							Spring load <sup>1)</sup>		<u>B</u>	Ĭ	Art. No.
<b>d</b> <sub>1</sub> -0.02 -0.04	d <sub>2</sub>	d <sub>3</sub>	I <sub>1</sub>	l <sub>2</sub>	l <sub>3</sub>	I <sub>4</sub>	F <sub>1</sub> ~	F <sub>2</sub> ~	max.		
[mm]								[N]	[°C]	[g]	
without plastic cover for grip – picture 1, stainless steel											
8	M20 x 1,5	20	69	12	36	37	21	57.5	250	119	22120.0328

<sup>1)</sup> statistical average value

www.halder.com Page 1 of 2 Published on: 5.11.2022

## **Accessories**

	Dimensions d <sub>2</sub>	Wrench size	ă	Art. No.						
	[mm]	[mm]	[9]							
Lock nuts ISO 8675 (DIN 439), stainless steel										
	M20 x 1,5	30	32.0	22120.0520						

# Compliance

## **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863

## Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 10.06.2022

## Does not contain Proposition 65 substances

No Proposition 65 substances included https://www.P65Warnings.ca.gov/

# **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2
Published on: 5.11.2022