




Fibre optic through beam sensor

FE-11-EPA-M4/F217X0,06/2M

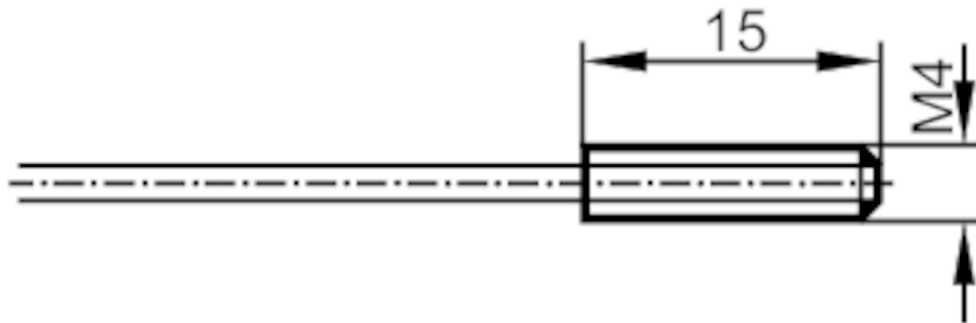

Application	
Function principle	Through-beam sensor
Detection zone	
Range with fibre optic amplifier type	OB50; OBF; OO50
OB50	
Range of fibre optics [mm]	50
OBF	
Range of fibre optics [mm]	56
OO50	
Range of fibre optics [mm]	120
Operating conditions	
Ambient temperature [°C]	-40...60

E21104



Fibre optic through beam sensor

FE-11-EPA-M4/F217X0,06/2M

Mechanical data	
Weight [g]	35
Version of sensing head	straight
Sensing head thread	M4
Sensing head length [mm]	15
Total length [mm]	2000
Min. bending radius [mm]	3
Fibre arrangement	
Core diameter [mm]	0.5
Fibre diameter [mm]	217 x 0.06
External diameter [mm]	1
Fibre material	PMMA
Fibre head material	aluminium
Fibre sheath material	PE
Accessories	
Accessories (supplied)	hexagon nuts: 4 x M4
	tooth lock washers: 4
	Adapter: OBF
Accessories (optional)	Adapter: OOF
	Cutter for fibre optics, E20600
Remarks	
Pack quantity	1 pcs.