# Rubber Endstop Buffers • cylindrical

# 25150.1407



## **Product Description**

To be used as an elastic end-stop, bearing foot etc.

The hardness is 55  $\pm$ 5° shore A. Further shore hardnesses (40  $\pm$ 5° shore A and 70  $\pm$ 5° shore A) on request.

#### Material

#### Support washer

Stainless steel 1.4301

#### Body

• Rubber natural caoutchouc (NR), black

### Screw


· Stainless steel 1.4301

#### More information


#### **Further products**

· Support Legs, Impact cushioning

### **Drawing**

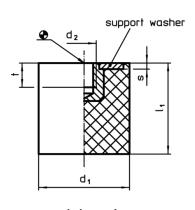

picture 1

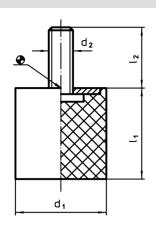



picture 2

### Order information

| d <sub>1</sub>                          | Dimensions |    |    |        | Spring rate R | Load capacity<br>max. | Spring range ~ | min. | max. | ă   | Art. No.   |
|---|------------|----|----|--------|---------------|-----------------------|----------------|------|------|-----|------------|
|   | [mm]       |    |    | [N/mm] | [N]           | [mm]                  | [°C]           |      | [g]  |     |            |
| with screw – picture 2, stainless steel |            |    |    |        |               |                       |                |      |      |     |            |
| 10                                      | 15         | M4 | 10 | 1.2    | 21            | 78                    | 3.75           | -30  | 80   | 2.6 | 25150.1407 |

### **Application example**

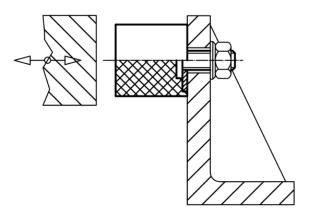

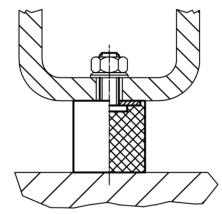



www.halder.com Page 1 of 2
Published on: 5.11.2022

### Compliance

### **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863

### Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 10.06.2022

#### Does not contain Proposition 65 substances

No Proposition 65 substances included https://www.P65Warnings.ca.gov/

#### **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2
Published on: 5.11.2022