Handwheels • DIN 950 cast iron

24580.0550



Product Description

Hub machined; rim turned and mirror-finished on all sides, non-machined surfaces cleanly blasted.

Material

Handwheel

· Cast iron GG

Machine handle DIN 39 EH 24450.

• Steel, turned, zinc-plated by galvanization, passivated

Assembly


Shaft-end washers EH 22270. for axial fastening.

More information

Further products

- · Shaft-End Washers
- Rotating Machine Handles, DIN 98

Drawing

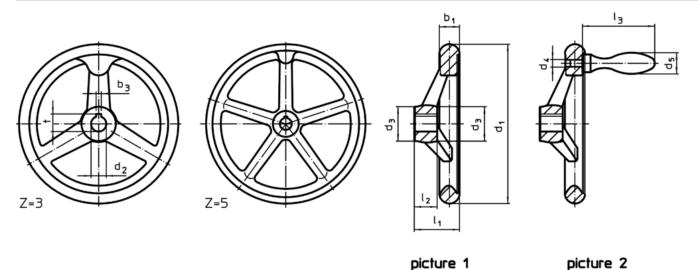

The orientation of the hub keyway may be different than shown in the drawing.

Erwin Halder KG


Order information

| Dimensions | | | | | | | | | b keyway, 8885 sheet 1 | Number of spokes | Corresponding machine handle | Ĭ | Art. No. |
|--|-----------------|----------------|----------------|----------------|------------------|----------------|------------------|-----------------------|---------------------------|------------------|------------------------------|------|------------|
| d ₁ | d₂ H7 | d ₃ | d ₄ | d ₅ | I ₁ ~ | l ₂ | l ₃ ~ | b ₃ | t | z | DIN 39 / DIN 98 | | |
| [mm] | | | | | | | | | [mm] | | [mm] | [kg] | |
| with keyway, with machine handle EH 24450. assembled, form N-F/G (formerly: F 3) – picture 2 | | | | | | | | | | | | | |
| 400 | 30 | 65 | M16 | 36 | 63 | 38 | 112 | 8 | 33.3 | 5 | 36 | 10.5 | 24580.0550 |



www.halder.com Page 1 of 2 Published on: 4.11.2022

Application example

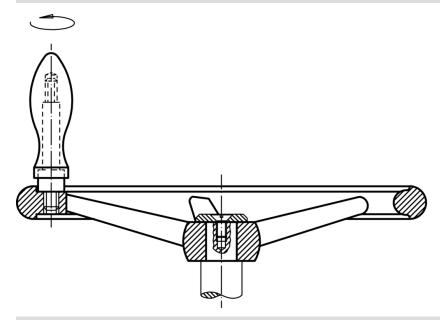

Compliance

RoHS compliant

Contains lead - compliant according to exceptions 6a / 6b / 6c

Contains SVHC substances >0,1% w/w

Contains lead - SVHC list [REACH] as of 10.06.2022

Contains Proposition 65 substances



Lead can cause cancer and reproductive harm from exposure https://www.P65Warnings.ca.gov/

Free from Conflict Minerals

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



Erwin Halder KG

www.halder.com Page 2 of 2

Published on: 4.11.2022